


Sample Company

Location

Outdoor Substation


2500kVA Transformer

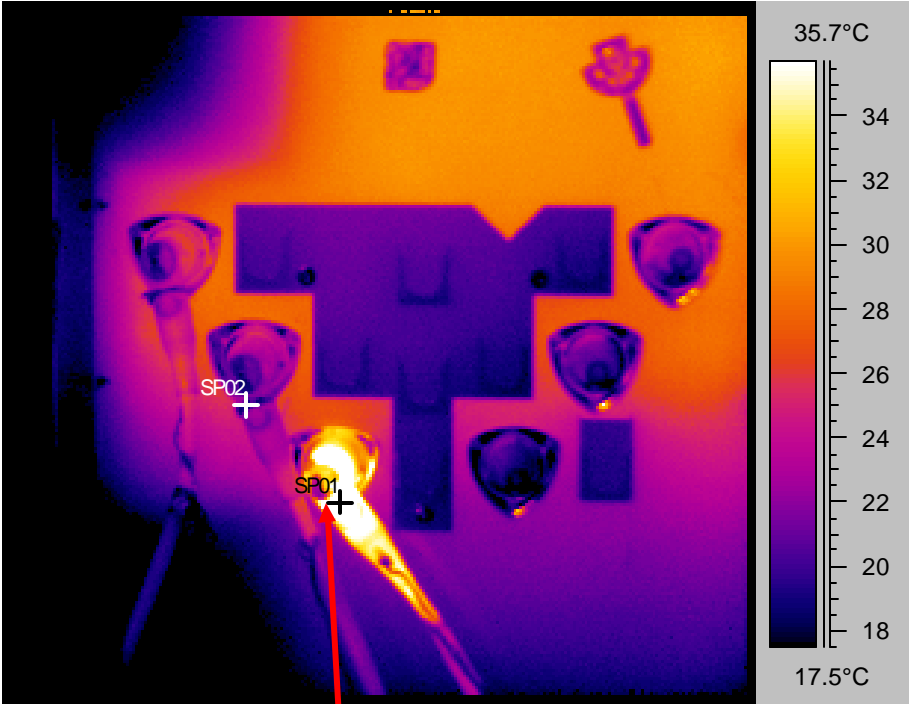

Problem #	1
Repair Priority	Critical
Hot Spot	43.0°C
Ref. Temp	19.0°C
Delta T	24.0
Time	Any Time
Date	Any Day

Evaluation

The connection is overheating by **24°C**. High Voltage elbow terminator may have a defective "cable-to-terminator" connection inside the elbow terminator.

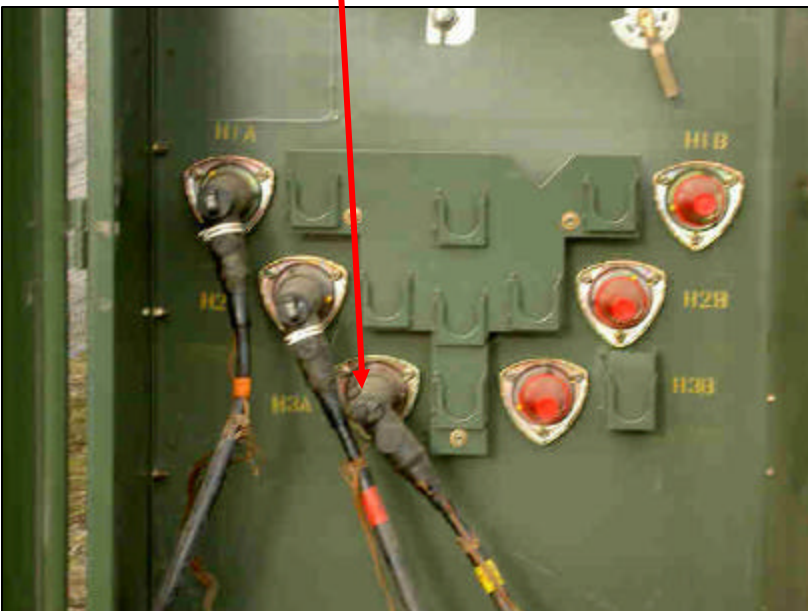

Recommendations

Replace the deficient High Voltage elbow terminator. Based on our experience, the best solution is to replace the elbow terminator.

Repair Priority

Critical Repair Priority - Repair as soon as possible.

MIDWEST ELECTRICAL TESTING

WWW.SWGR.COM

Milwaukee Division

5141 North 35th Street

Milwaukee, WI 53209

414.931.0992 / Fax 414.461.8485

Fox Valley Division

1060 Breezewood Lane, Suite #4

Neenah, WI 54956

920.727.1600 / Fax 920.727.1620