
Sample Company

Location

Main Electrical Room

Switch #1

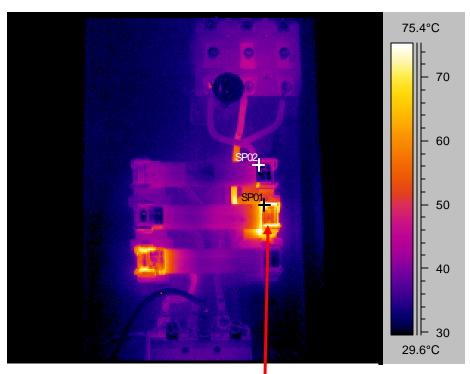

Problem #	3
Repair Priority	Urgent
Hot Spot	79.4°C
Ref. Temp	36.0°C
Delta T	43.4
Time	Any Time
Date	Any Day

Evaluation

The lower left and center right fuse clips are hot. Loose wire connections or poor fuse clip tension is suspected.



Recommendations

Remove all the fuses, clean the fuse contact areas and fuse clip contact areas, reassemble. Check fuse clips for proper tension. Replace if necessary. Clean the wire to lug connection. Check all the lugs for proper torque.

Repair Priority

Urgent Repair Priority - Repair at earliest opportunity.

MIDWEST ELECTRICAL TESTING

WWW.SWGR.COM

Milwaukee Division

5141 North 35th Street Milwaukee, WI 53209 414.931.0992 / Fax 414.461.8485

Fox Valley Division

1060 Breezewood Lane, Suite #4 Neenah, WI 54956 920.727.1600 / Fax 920.727.1620