


# Sample Company

## Location

Main Electrical Room

Switch #1

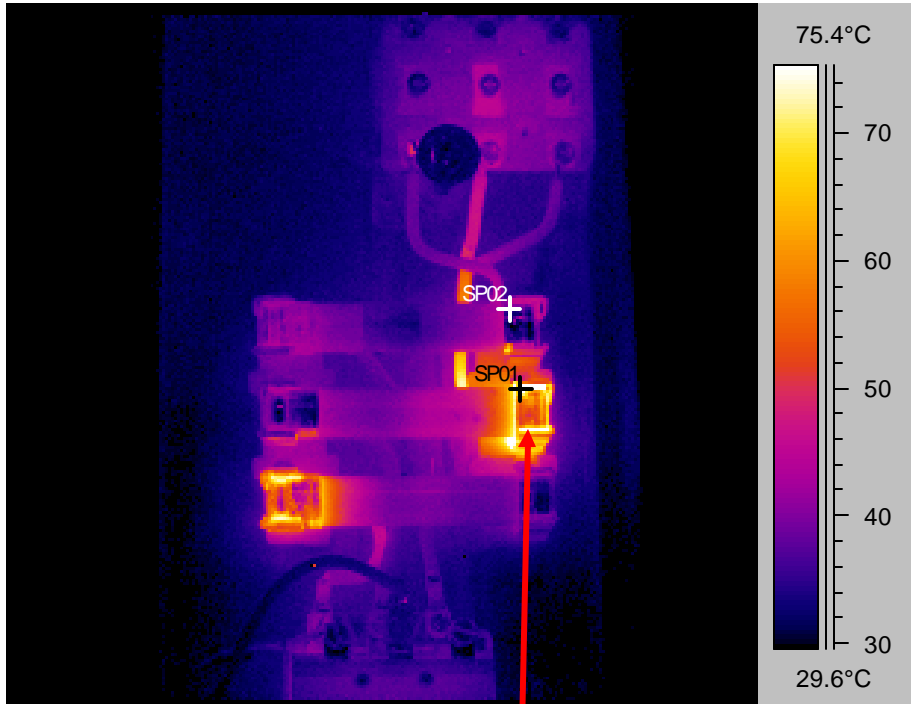

<b>Problem #</b>	<b>3</b>
<b>Repair Priority</b>	<b>Urgent</b>
<b>Hot Spot</b>	<b>79.4°C</b>
<b>Ref. Temp</b>	<b>36.0°C</b>
<b>Delta T</b>	<b>43.4</b>
<b>Time</b>	<b>Any Time</b>
<b>Date</b>	<b>Any Day</b>

## Evaluation

The lower left and center right fuse clips are hot. Loose wire connections or poor fuse clip tension is suspected.



## Recommendations

Remove all the fuses, clean the fuse contact areas and fuse clip contact areas, reassemble. Check fuse clips for proper tension. Replace if necessary. Clean the wire to lug connection. Check all the lugs for proper torque.

## Repair Priority

**Urgent Repair Priority** - Repair at earliest opportunity.

**MIDWEST ELECTRICAL TESTING**

**WWW.SWGR.COM**

### Milwaukee Division

5141 North 35th Street  
Milwaukee, WI 53209

414.931.0992 / Fax 414.461.8485

### Fox Valley Division

1060 Breezewood Lane, Suite #4  
Neenah, WI 54956

920.727.1600 / Fax 920.727.1620